

## **Appendix 18.6**

# **HERITAGE ASSET SCHEDULE & PLANS**





THIS DRAWING IS COPYRIGHT PROTECTED AND MAY NOT BE REPRODUCED IN WHOLE OR PART WITHOUT WRITTEN AUTHORITY FROM THE OWNER.

NOTES:

1. Do not scale from this drawing.  
2. Always work to noted dimensions.  
3. All dimensions are in millimetres unless otherwise stated.  
4. All setting out levels and dimensions to be agreed on site.  
5. The dimensions of all materials must be checked on site before being laid out.  
6. This drawing must be read with the relevant specification clauses and detail drawings.  
7. Order of construction and setting out to be agreed on site.

KEY

BOUNDARIES KEY

Approximate Extent of Listed Structures

HERITAGE ARTEFACTS CLASSIFICATION KEY

Retain in-situ - as found

Retain in-situ - repair / remediate

Retain in-situ - repair / remediate  
(previously identified as a non-designated artefact)

Retain - Requires further investigation from civils team

Relocated from elsewhere on site

D1-P0614-07-20AmendmentsSSDM

D1-P0623-06-20Addition of rail tracksSSDM

D1-P0631-05-20For informationSSDM

S1-P0228-09-20For informationSSDM

S1-P0320-04-20For informationSSDM

Revision	Date	Description	Drawn	Apprv.
----------	------	-------------	-------	--------

Plant1 I.E. Limited

Info: info@plant1-ie.com

W: plant1-ie.com

MANCHESTER

2 Back Grafton St., Altrincham, WA14 1DY

T: 0161 928 9281

LONDON

Unit 6 Waterside, 44-48 Wharf Road, London, N1 7UX

T: 0207 253 5678

LIVERPOOL

Tempest 3.3, 12 Thibarn Street, Liverpool, L2 2DT

T: 0151 363 1230

Client

Everton Stadium Development Limited

Project

The Peoples Project

Dwg Title

GA Plan  
Heritage Assets Retained

Created on

Created by

Approved by

2020-04-20

SS

DM

Scale

Size

Workstage

1:500

A1

Stage 3

Dwg No.

Suitability

Revision


BMD01-PLA-SO-EX-DR-L-948405

D1

P05

© Plant1 I.E. Limited



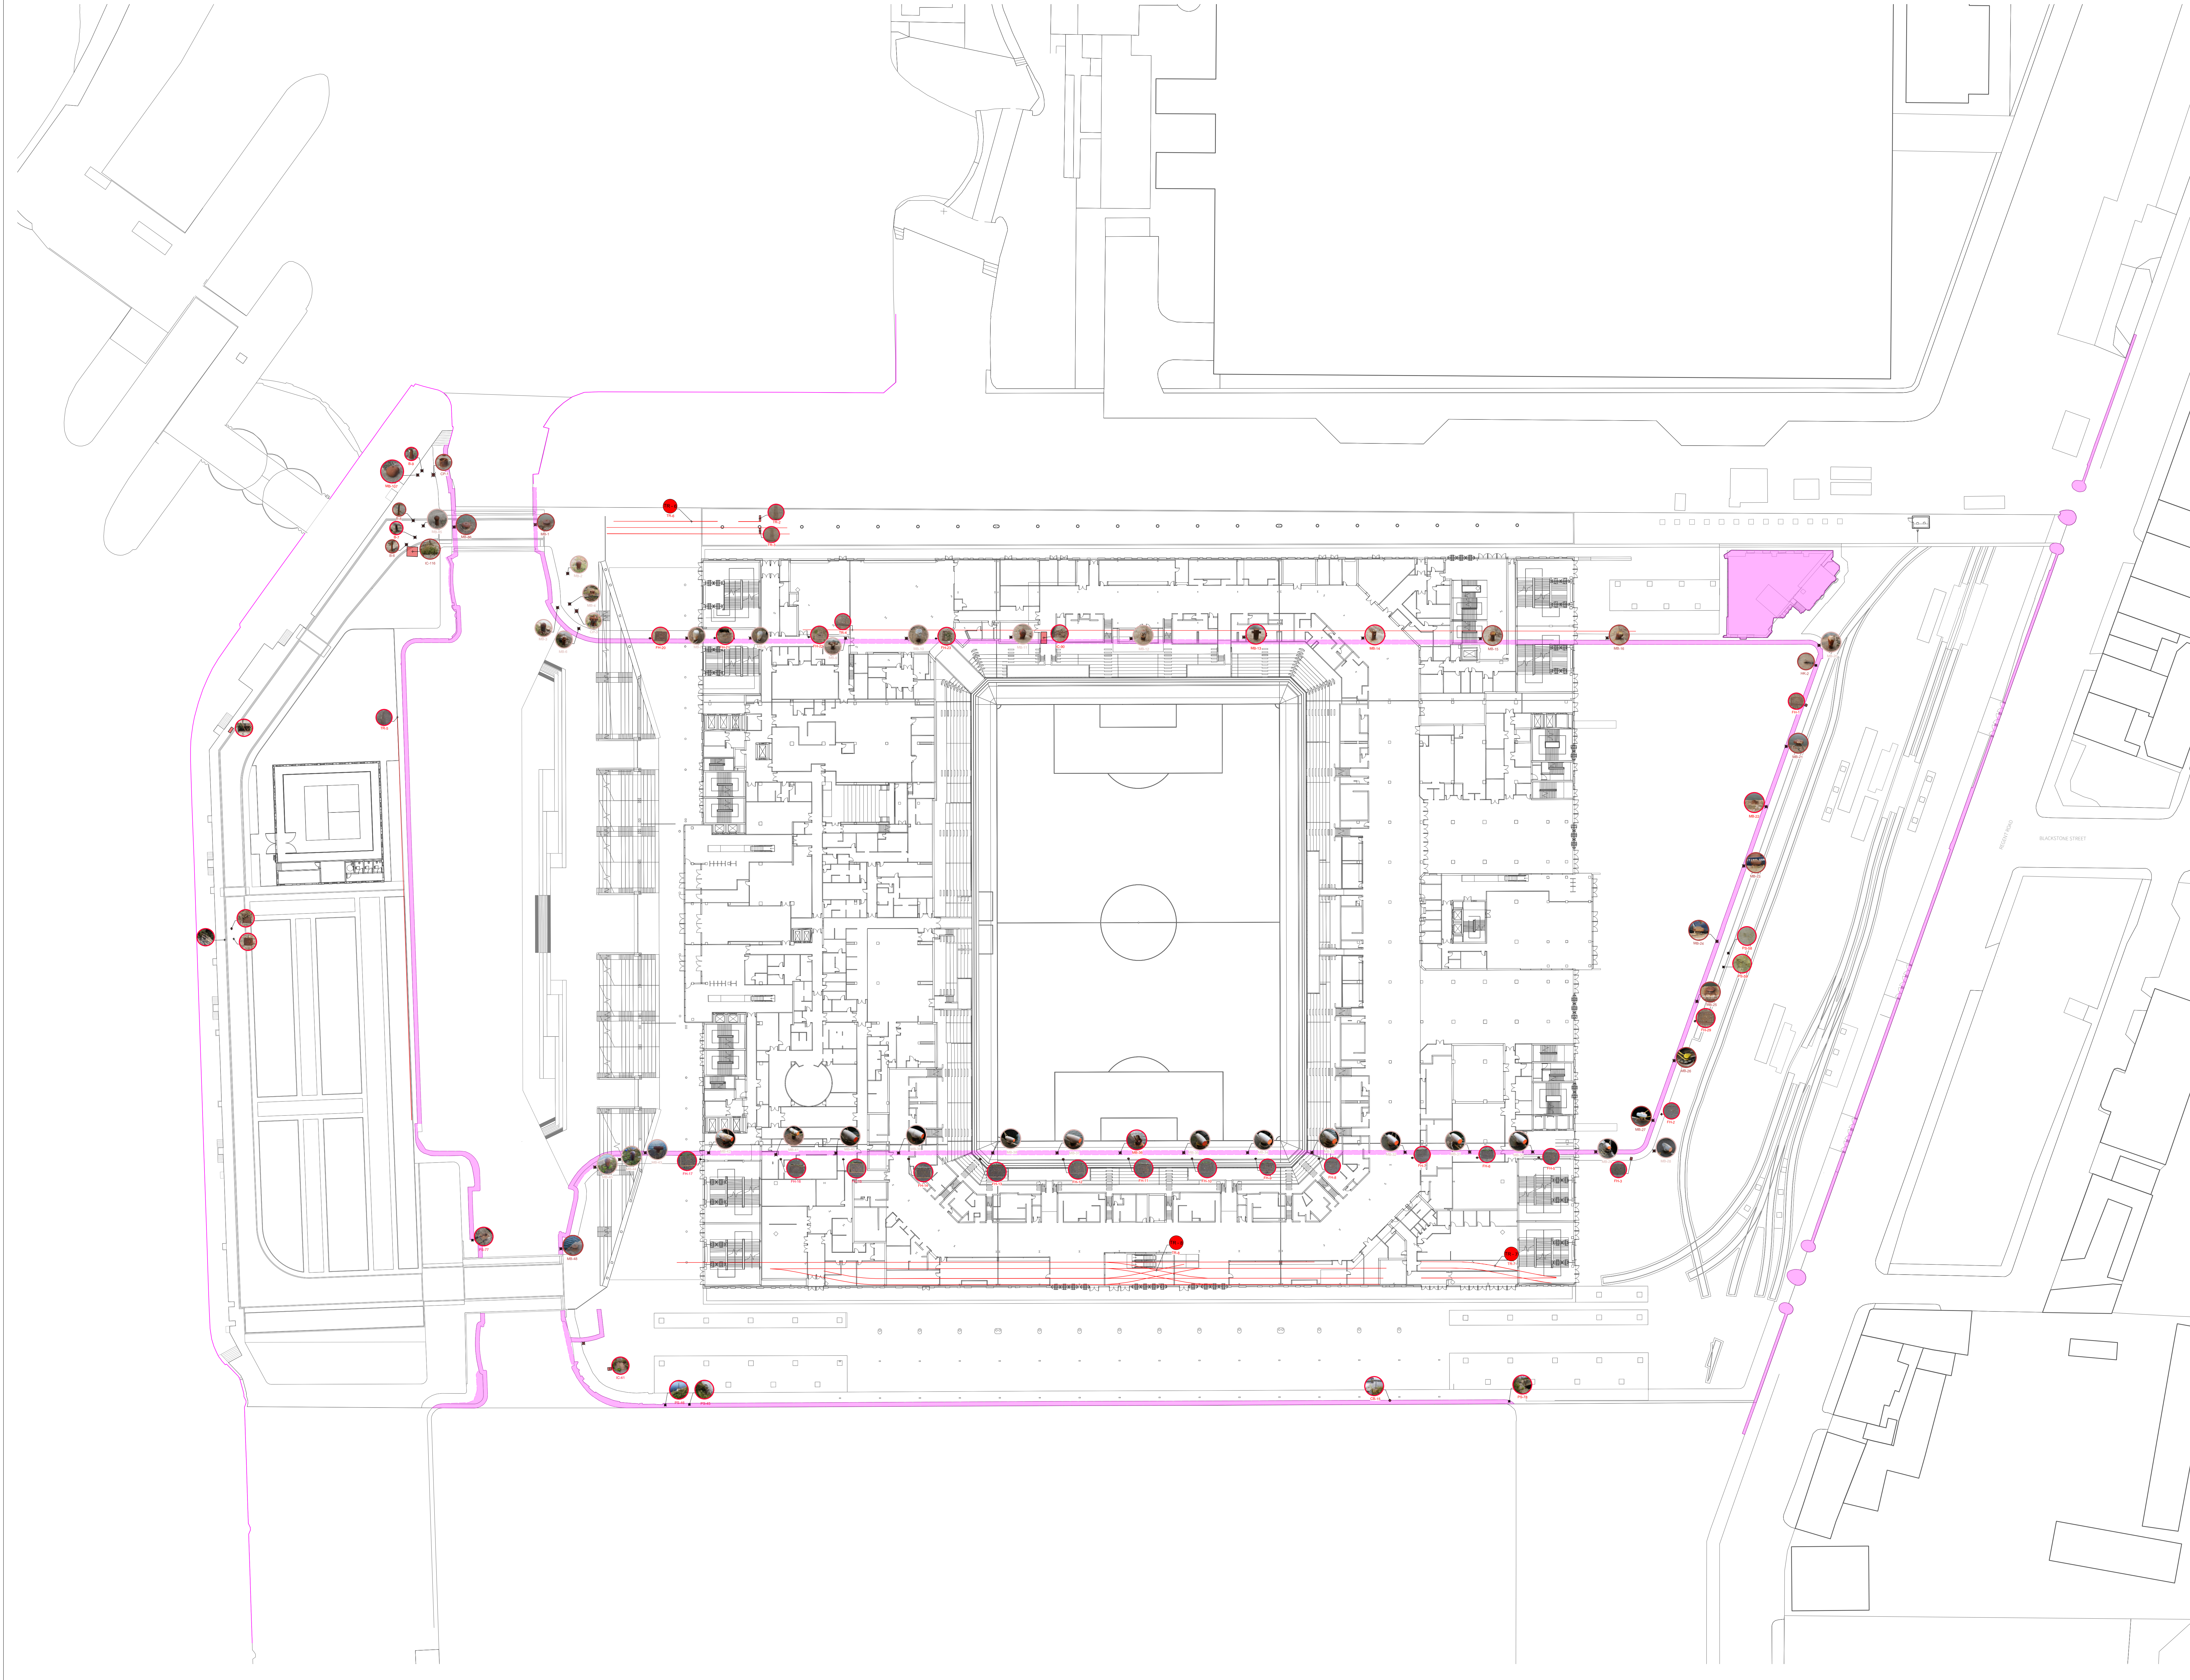

THIS DRAWING IS COPYRIGHT PROTECTED AND MAY NOT BE REPRODUCED IN WHOLE OR PART WITHOUT WRITTEN AUTHORITY FROM THE OWNER.

NOTES:

1. Do not scale from this drawing.  
2. Always work to noted dimensions.  
3. All dimensions are in millimetres unless otherwise stated.  
4. All setting out levels and dimensions to be agreed on site.  
5. The dimensions of all materials must be checked on site before being laid out.  
6. This drawing must be read with the relevant specification clauses and detail drawings.  
7. Order of construction and setting out to be agreed on site.

KEY

BOUNDARIES KEY

Approximate Extent of Listed Structures

HERITAGE ARTIFACTS CLASSIFICATION KEY

Remove and Relocate on site

Remove and Store off site

Remove and Dispose off site

D1-P06	14-07-20	Amendments	SS	DM
D1-P04	23-06-20	Addition of rail tracks	SS	DM
D1-P03	31-05-20	For information	SS	DM
S1-P02	28-05-20	For information	SS	DM
S1-P01	20-06-20	For information	SS	DM

Revision	Date	Description	Drawn	Apprvd.

Plant1 I.E. Limited

E: info@plant1-ie.com

W: plant1-ie.com

MANCHESTER

2 Back Grafton St., Altrincham, WA14 1DY

T: 0161 928 9281

LONDON

Unit 6 Waterside, 44-48 Wharf Road, London, N1 7UX

T: 0207 253 5678

LIVERPOOL

Tempest 3.3, 22 Tithebarn Street, Liverpool, L2 2DT

T: 0151 363 1230

Client

Everton Stadium Development Limited

Project

The Peoples Project

Dwg Title

GA Plan  
Heritage Assets Removed

Created on

2020-04-20

Created by

SS

Approved by

DM

Scale

1:500

Size

A1

Workstage

Stage 3

Dwg No.

BMD01-PLA-S0-EX-DR-L-048404

Suitability




D1

Revision

P05

© Plant1 I.E. Limited



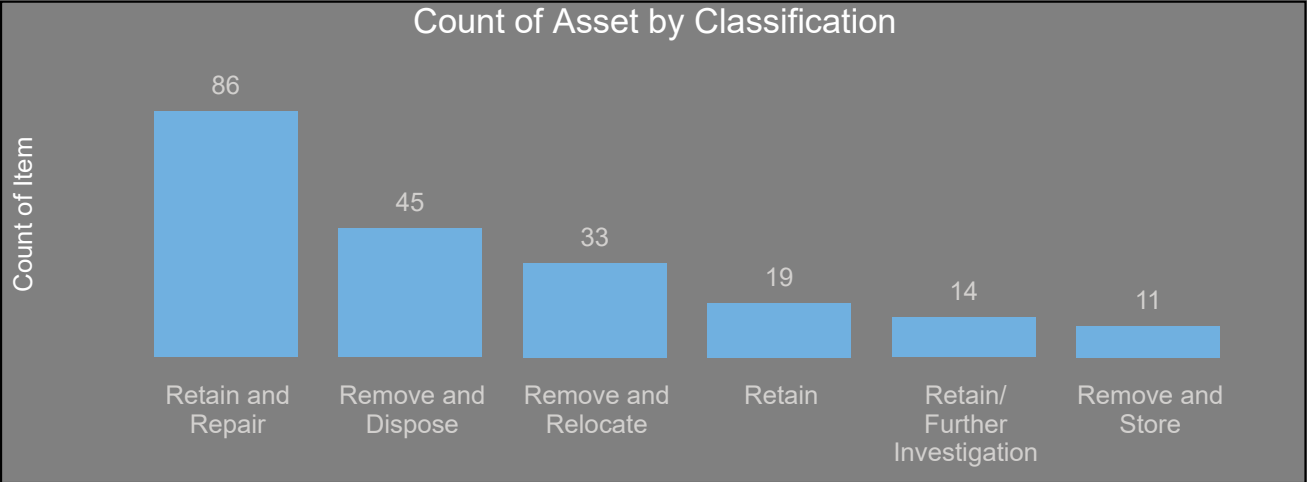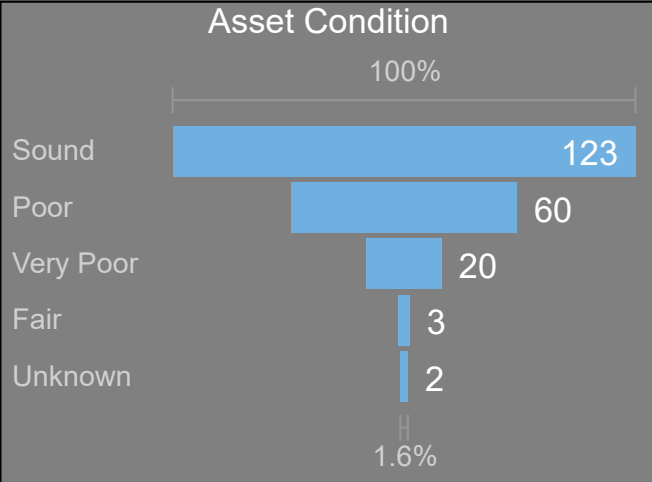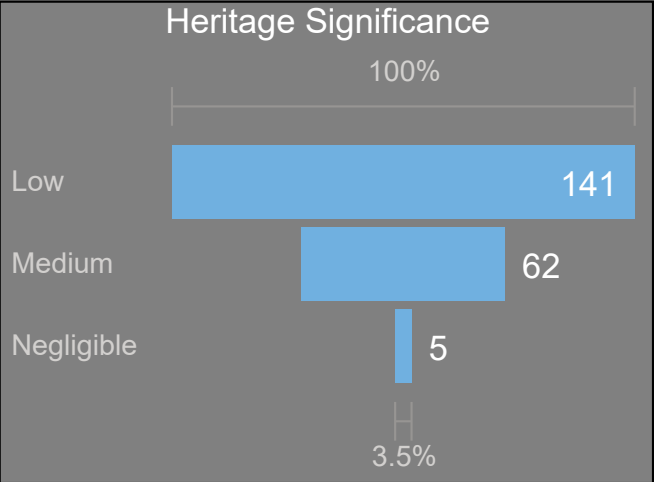


Count of Asset by Item Type

Item	Count of Item
Weir	1
Type 3 - Mooring Bollard	25
Type 2 - Mooring Bollard	12
Type 1 - Mooring Bollard	52
Track	14
Timber	1
Stone	1
Post	16
Metal	2
Lock Gate	6
Ladder	1
Inspection Chamber	13
Hook/Chain	12
Gulley	10
Gate Rail	3
Total	208



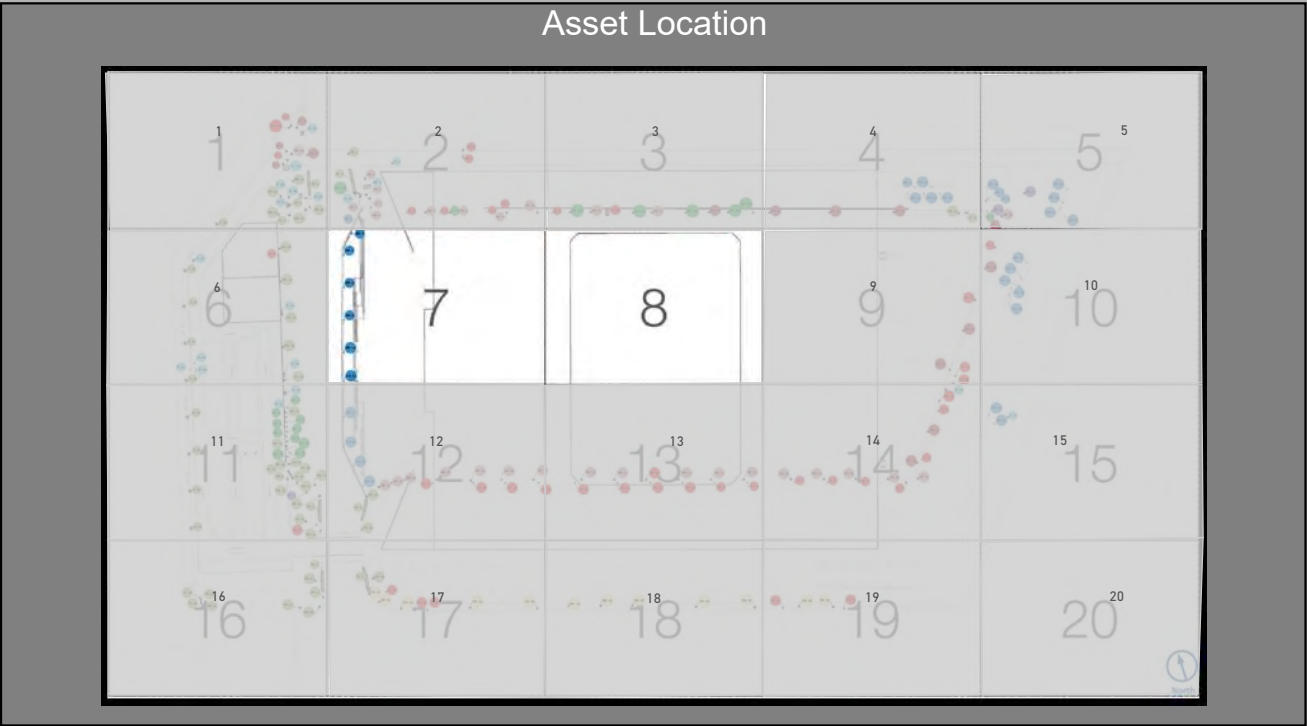


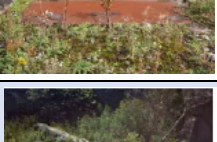

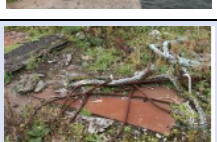

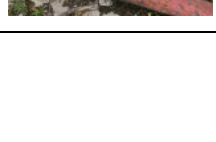
Count of Asset by Item Type

RefNO.	Count of Item
B6	1
B7	1
B8	1
B9	1
CP1	1
CP2	1
CP3	1
CP4	1
DWG1	1
DWG2	1
DWG3	1
FH1	1
FH10	1
FH11	1
FH12	1
FH13	1
Total	208




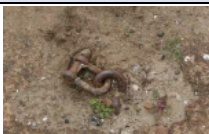










Date: 11/09/2020







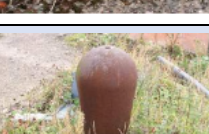






Heritage Asset Schedule - Updated with Heritage Significance

Ref NO.	ITEM	AREA	REFERENCE TILE	MATERIAL/DESCRIPTION	HERITAGE VALUE (BY KM HERITAGE)	Original to dock construction	Attached to Listed Structure	Curtilage	Condition	Heritage Significance	IMAGE	CLASSIFICATION	NOTES/RECOMMENDATIONS
B6	Bollard	West Quay	1	•Cast iron bollard •Rusted/corroded surface	•An historical artefact of a generic type. •Part of the listed dock	Yes	No	Yes	Poor	Medium		Remove and Store	Remove as surface needs levelling. Remove any sharp chain connections if corroded. Element to be stored for re-use.
B7	Bollard	West Quay	1	•Severely damaged •Cast iron bollard •Rusted/damaged paintwork	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Remove and Dispose	Remove due to damage.. Dispose of damaged bollard.
B8	Bollard	West Quay	1	•Cast iron bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Poor	Medium		Remove and Store	Remove as surface needs levelling. Remove any sharp chain connections if corroded. Store bollard for potential reuse.
B9	Bollard	West Quay	1	•Severely damaged •Cast iron bollard •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Remove and Dispose	Remove due to damage and poses trip hazard in pedestrian circulation space. Dispose of damaged bollard.
CP1	Capstan	West Quay	1	•Metal capstan base •Rusted/corroded surface •Internal mechanism visible	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Unknown	No	Yes	Very Poor	Medium		Remove and Store	This is within close proximity to works required to form the dock isolation structure and will be susceptible to damage during construction works. Element to be stored for re-use.  Included on the Additional Heritage survey.
CP2	Capstan	West Quay	1	•Metal capstan •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Situated in future pedestrian zone with seating. Could be made into an attractive feature.  Included on the Additional Heritage survey.
G30	Gulley	West Quay	1	•Cast iron gulley cover •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Unknown	No	Yes	Sound	Low		Retain and Repair	Attractive geometric pattern. Not fully visible.  Included on the Additional Heritage survey.
GA1	Lock Gate	West Quay	1	•Timber and metal	•The lock gates were an intrinsic part of the workings of the docks and thus possess heritage significance in themselves •Part of the listed dock	No	Yes	No	Poor	Medium		Retain and Repair	Gates have been replaced over time - pintail positions modified. Repair to former condition (above low water line) and retain as important heritage feature.
IC60	Inspection Chamber	West Quay	1	•Metal cover •Rusted/corroded surface •Dimensions: 450 (W) x 1050 (L) mm (approx.)	•An historical artefact of a generic type •Part of the listed dock	No	No	No	Poor	Low		Retain/ Further Investigation	Modern cover over original lock gate chain pit. Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  Included on the Additional Heritage survey.
IC61	Inspection Chamber	West Quay	1	•Metal cover •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Retain/ Further Investigation	Modern cover over original lock gate chain pit. Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  Included on the Additional Heritage survey.














IC62	Inspection Chamber	West Quay	1	•Double metal cover •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain/ Further Investigation	Modern cover over chain pit. This occurs adjacent new isolation structure. Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification. If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  Included on the Additional Heritage survey.
IC85	Inspection Chamber	West Quay	1	•Filled in with debris •Missing cover •Concrete surround	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Very Poor	Low		Retain/ Further Investigation	Purpose of the chamber to be determined, if remaining in use, remove debris, install cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  Included on the Additional Heritage survey.
IC116	Inspection Chamber	West Quay	1	•Filled in with debris/plants •Missing cover •Concrete surround	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Very Poor	Low		Remove and Dispose	Purpose of the chamber to be determined.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  Included on the Additional Heritage survey.
LD1	Ladder	West Quay	1	•Metal ladder to dock wall •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Retain and Repair	Assess CDM Risk. Retain in place, inspect to check integrity for use.
MB80	Type 1 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface •Flat side	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Medium		Retain and Repair	Situated in future pedestrian zone with seating. Location appears outside of construction zone.  Retain in-situ for use during marine works. Protect, if required, during construction works.
MB81	Type 1 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated in future pedestrian zone with seating. Location appears outside of construction zone.  Retain in-situ for use during marine works. Protect, if required, during construction works.
MB82	Type 2 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface •Low to ground (<200mm (H)) •Concave edge profile	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated in future pedestrian zone with seating. Location appears outside of construction zone.  Retain in-situ for use during marine works. Protect, if required, during construction works.
MB83	Type 1 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated in future pedestrian zone with seating. Location appears outside of construction zone.  Retain in-situ for use during marine works. Protect, if required, during construction works.
MB84	Type 1 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated in future pedestrian zone with seating. Location appears outside of construction zone.  Retain in-situ for use during marine works. Protect, if required, during construction works.
MB85	Type 1 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future vehicle circulation path. This is within close proximity to construction works.  Element to be stored for re-use on site.
MB86	Type 2 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface •Low to ground (<200mm (H)) •Concave edge profile	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Remove and Store	This is within close proximity to isolation structure construction works and sits within future vehicle circulation path.  Element to be stored for potential re-use.
MB107	Type 1 - Mooring Bollard	West Quay	1	•Cast iron mooring bollard •Rusted/corroded surface •Flat side •Base not visible/missing	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Very Poor	Low		Remove and Dispose	Remove and dispose of damaged bollard.



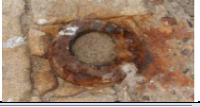






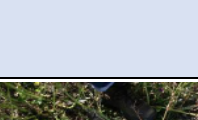

MT4	Metal	West Quay	1	<ul style="list-style-type: none"> <li>•Metal Sheet</li> <li>•Rusted/corroded surface</li> <li>•Dimensions: 1000 (W) x 2500 (L) mm (approx.)</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Poor	Low		Retain/ Further Investigation	<p>Situated in future pedestrian zone with seating. Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification. If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works .</p> <p>Included on the Additional Heritage survey.</p>
CP3	Capstan	North Quay	2	<ul style="list-style-type: none"> <li>•Cast Iron Gate Mechanism</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Poor	Medium		Remove and Relocate	<p>Remove as item sits within future vehicle circulation path. This is within close proximity to construction works.</p> <p>Element to be stored for re-use on site.</p> <p>Included on the Additional Heritage survey.</p>
GA2	Lock Gate	North Quay	2	<ul style="list-style-type: none"> <li>•Timber and Metal Dock gate</li> </ul>	<ul style="list-style-type: none"> <li>•The dock gates were intrinsic to the working of the docks and thus possess heritage significance in themselves</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Poor	Medium		Retain and Repair	<p>Repair (above low water line) and retain as important heritage feature.</p>
HK1	Hook/Chain	North Quay	2	<ul style="list-style-type: none"> <li>•Hook and eye</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Poor	Low		Retain	<p>Retain in-situ - below suspended slab of stadium.</p> <p>Included on the Additional Heritage survey.</p>
IC3	Inspection Chamber	North Quay	2	<ul style="list-style-type: none"> <li>•Cast Iron cover</li> <li>•Rusted/corroded surface</li> <li>•Textured finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain/ Further Investigation	<p>Proposed levels need to be raised in this area. Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification. If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.</p> <p>Included on the Additional Heritage survey.</p>
FH20	Fire Hydrant	North Quay	2	<ul style="list-style-type: none"> <li>•Cast Iron cover</li> <li>•Rusted/corroded surface</li> <li>•Textured square pattern finish</li> <li>•Flip lid</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Poor	Low		Remove and Dispose	<p>Cover of early Fire Hydrant distribution network - possibly connected to hydraulic system. The inspection chamber and connected piped services will clash with foundations and will need to be removed.</p> <p>Included on the Additional Heritage survey.</p>
FH21	Fire Hydrant	North Quay	2	<ul style="list-style-type: none"> <li>•Cast Iron fire hydrant cover</li> <li>•Rusted/corroded surface</li> <li>•Flip lid</li> <li>•Textured finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Remove and Dispose	<p>The inspection chamber and connected piped services will clash with foundations and will need to be removed.</p> <p>Included on the Additional Heritage survey.</p>
FH22	Fire Hydrant	North Quay	2	<ul style="list-style-type: none"> <li>•Cast Iron cover</li> <li>•Rusted/corroded surface</li> <li>•Flip lid</li> <li>•Textured finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Remove and Dispose	<p>The inspection chamber and connected piped services will clash with foundations and will need to be removed.</p> <p>Included on the Additional Heritage survey.</p>
IC86	Inspection Chamber	North Quay	2	<ul style="list-style-type: none"> <li>•Overgrown, filled in and littered with cables</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Unknown	Yes	No	Poor	Low		Retain/ Further Investigation	<p>The inspection chamber will need clearing out, made safe and the cover will need replacing.</p> <p>Included on the Additional Heritage survey.</p>
MB1	Type 2 - Mooring Bollard	North Quay	2	<ul style="list-style-type: none"> <li>•Cast iron mooring bollard</li> <li>•Rusted/corroded surface</li> <li>•Low to ground (&lt;200mm (H))</li> <li>•Concave edge profile</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	Yes	No	Sound	Medium		Remove and Store	<p>Located in quiet pedestrian circulation space. Clashes with the new isolation structure and will need to be removed. Remove/ Store or Dispose TBC</p>
MB2	Type 1 - Mooring Bollard	North Quay	2	<ul style="list-style-type: none"> <li>•Cast iron mooring bollard</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Remove and Relocate	<p>Remove as item sits within future vehicle circulation path and is within close proximity to construction works.</p> <p>Element to be stored for future re-use on site.</p>
MB3	Type 1 - Mooring Bollard	North Quay	2	<ul style="list-style-type: none"> <li>•Cast iron mooring bollard</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Remove and Relocate	<p>Remove as item sits within future vehicle circulation path and is within close proximity to construction works.</p> <p>Element to be stored for future re-use on site.</p>
















MB4	Capstan	North Quay	2	•Cast iron mooring bollard •Rusted/corroded surface •Low to ground (<300mm (H)) •Concave edge profile	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Relocate	Remove as item sits within future vehicle circulation path and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB6	Type 1 - Mooring Bollard	North Quay	2	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future vehicle circulation path and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB7	Type 1 - Mooring Bollard	North Quay	2	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB8	Type 1 - Mooring Bollard	North Quay	2	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB9	Type 1 - Mooring Bollard	North Quay	2	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB10	Type 1 - Mooring Bollard	North Quay	2	•Cast iron mooring bollard •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB108	Type 2 - Mooring Bollard	North Quay	2	•Cast iron base •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	Yes	No	Very Poor	Medium		Retain	Location appears outside of construction zone.  Retain in-situ for use during marine works. Protect, if required, during construction works.
MT1	Metal	North Quay	2	•Rectangular flat sheet metal inspection cover •Rusted/corroded surface •Textured finish	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Retain/ Further Investigation	Purpose of the metal to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  Included on the Additional Heritage survey.
TR1	Track	East Quay	9	•Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Unknown	No	Yes	Poor	Low		Retain and Repair	The track plate will need to be retained and used as an edge for new surface materials.
TR2	Track	North Quay	2	•Cast iron •Rusted/corroded surface •Textured raised surface	•An historical artefact of a generic type •Part of the listed dock	No	No	No	Sound	Negligible		Remove and Dispose	<b>Cast iron drainage grating - fitted between rail tracks.</b> Remove as levels to be raised in this area. Element to be disposed off site.
TR3	Track	North Quay	2	•Cast iron •Rusted/corroded surface •Textured raised surface	•An historical artefact of a generic type •Part of the listed dock	No	No	No	Sound	Negligible		Remove and Dispose	Remove as levels to be raised in this area. Element to be disposed off site.
FH9	Fire Hydrant	North Quay	3	•Cast iron •Rusted/corroded surface •Silted up	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Very Poor	Low		Remove and Dispose	The inspection chamber and connected piped services will clash with foundations and will need to be removed and disposed off site.  Included on the Additional Heritage survey.
IC90	Inspection Chamber	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Remove and Dispose	The inspection chamber and connected piped services will clash with foundations and will need to be removed and disposed off site.  Included on the Additional Heritage survey.







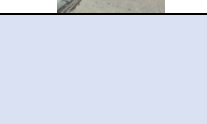

MB11	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB12	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB13	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Remove and Dispose	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element not in great condition and so to be removed and disposed off site.
MB109	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Retain	Located below suspended slab of stadium and avoids new foundations.  Retain in-situ for use during marine works. Protect, if required, during construction works.  Could clash with stadium foundations awaiting NH from BHE to confirm.
MB110	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Retain	Located below suspended slab of stadium and avoids new foundations.  Retain in-situ for use during marine works. Protect, if required, during construction works.  Could clash with stadium foundations awaiting NH from BHE to confirm.
MB111	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Retain	Located below suspended slab of stadium and avoids new foundations.  Retain in-situ for use during marine works. Protect, if required, during construction works.  Could clash with stadium foundations awaiting NH from BHE to confirm.
MB112	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Retain	Located below suspended slab of stadium and avoids new foundations.  Retain in-situ for use during marine works. Protect, if required, during construction works.  Could clash with stadium foundations awaiting NH from BHE to confirm.
MB113	Type 1 - Mooring Bollard	North Quay	3	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	No	Yes	Very Poor	Low		Retain	Located below suspended slab of stadium and avoids new foundations.  Retain in-situ for use during marine works. Protect, if required, during construction works.  Could clash with stadium foundations awaiting NH from BHE to confirm.
IC10	Inspection Chamber	North Quay	4	•Cast iron •Rusted/corroded surface •Diamond texture	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Retain and Repair	Adjacent to the Hydraulic tower.  Retain in-situ. Protect, if required, during construction works. Repair to make good and structural integrity to be reviewed.  Included on the Additional Heritage survey.
MB14	Type 1 - Mooring Bollard	North Quay	4	•Cast iron •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element not in great condition and so to be removed and disposed off site.
MB15	Type 1 - Mooring Bollard	North Quay	4	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Store	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored off site.
MB16	Type 1 - Mooring Bollard	North Quay	4	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Store	Remove as item is within close proximity to construction works and future pedestrian circulation routes.  Element to be stored off site.
MB17	Type 1 - Mooring Bollard	North Quay	4	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Adjacent to the Hydraulic tower.  Retain in-situ. Protect, if required, during construction works. Repair to make good.


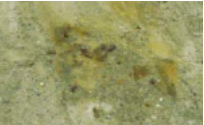












HK2	Hook/Chain	East Quay	5	<ul style="list-style-type: none"> <li>•Cast iron chain link</li> <li>•Rusted/corroded surface</li> <li>•Galvanised [?] chain</li> </ul>	<ul style="list-style-type: none"> <li>•The dock fixture is an historical artefact of a generic type</li> <li>•The chain is modern</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Poor	Low		Remove and Store	This is on the proposed pedestrian route Removal and to be stored off site.
MB20	Type 1 - Mooring Bollard	East Quay	5	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Remove and Relocate	<p>Remove as poses trip hazard in pedestrian circulation space.</p> <p>Element to be stored for future re-use on site.</p>
MB18	Type 1 - Mooring Bollard	East Quay	5	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	<p>Previously identified as a non-designated artefact.</p> <p>Retain in-situ. Protect, during construction works. Repair to made good.</p>
MB19	Type 1 - Mooring Bollard	East Quay	5	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	<p>Previously identified as a non-designated artefact.</p> <p>Retain in-situ. Protect, during construction works. Repair to made good.</p>
DWG1	Dock Wall Gate	East Quay	5	<ul style="list-style-type: none"> <li>•Timber frame</li> <li>•Timber slat infill</li> <li>•Cast Iron fixings</li> </ul>	<ul style="list-style-type: none"> <li>•A contemporary replica of the historic boundary wall gates</li> </ul>	No	Yes	Yes	Poor	Low		Remove and Dispose	Not previously identified as a designated artefact.
ST2	Stone	East Quay	5	Curved granite piece with smooth finish	<ul style="list-style-type: none"> <li>•An historical artefact probably made to protect the corner of the wall from wheel impact</li> <li>•Part of the curtilage of the listed Hydraulic Engine House</li> </ul>	No	No	Yes	Sound	Low		Retain	Retained adjacent to Hydraulic Tower.
G26	Gulley	West Quay	6	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	<p>The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.</p> <p>Retain in-situ. Protect, during construction works. Replace only if required.</p> <p><u>Included on the Additional Heritage survey.</u></p>
G27	Gulley	West Quay	6	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	<p>The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.</p> <p>Retain in-situ. Protect, during construction works. Replace only if required.</p> <p><u>Included on the Additional Heritage survey.</u></p>
G28	Gulley	West Quay	6	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	<p>The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.</p> <p>Retain in-situ. Protect, during construction works. Replace only if required.</p> <p><u>Included on the Additional Heritage survey.</u></p>
G29	Gulley	West Quay	6	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> <li>•Textured finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	<p>The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.</p> <p>Retain in-situ. Protect, during construction works. Replace only if required.</p> <p><u>Included on the Additional Heritage survey.</u></p>
FH24	Fire Hydrant	West Quay	6	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> <li>•1924 date stamp</li> <li>•Square textured finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Remove and Dispose	<p>Cover stamped with date - 1924. Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.</p> <p>If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.</p> <p><u>Included on the Additional Heritage survey.</u></p>
FH25	Fire Hydrant	West Quay	6		<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Unknown	No	Yes	Very Poor	Low		Remove and Dispose	<p>Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.</p> <p>If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.</p> <p><u>Included on the Additional Heritage survey.</u></p>
FH26	Fire Hydrant	West Quay	6	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Remove and Dispose	<p>Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.</p> <p>If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.</p> <p><u>Included on the Additional Heritage survey.</u></p>





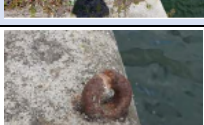






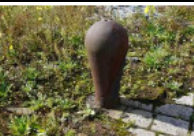



FH27	Fire Hydrant	West Quay	6	•Cast iron •Rusted/corroded surface •Missing cover	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Very Poor	Low		Remove and Dispose	Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  <u>Included on the Additional Heritage survey.</u>
FH28	Fire Hydrant	West Quay	6	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain/ Further Investigation	Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  <u>Included on the Additional Heritage survey.</u>
IC99	Inspection Chamber	West Quay	6	Missing cover	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain/ Further Investigation	Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  <u>Included on the Additional Heritage survey.</u>
MB75	Type 1 - Mooring Bollard	West Quay	6	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works. Repair to make good in line with landscape works.
MB76	Type 1 - Mooring Bollard	West Quay	6	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works. Repair to make good in line with landscape works.
MB77	Type 1 - Mooring Bollard	West Quay	6	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works. Repair to make good in line with landscape works.
MB78	Type 1 - Mooring Bollard	West Quay	6	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works. Repair to make good in line with landscape works.
MB79	Type 1 - Mooring Bollard	West Quay	6	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works. Repair to make good in line with landscape works.
TR4	Track	North Quay	2/3/4	•Cast Iron Track	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Poor	Low		Remove and Dispose	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be disposed off site.
TR5	Track	West Quay	6	•Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Unknown	No	Yes	Poor	Low		Retain and Repair	The track plate will need to be retained and used as an edge for new surface materials.
TR6	Track	South Quay	13	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Fair	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be used elsewhere on site to replace damage sections of track.
TR 7	Track	South Quay	18	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Fair	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be used elsewhere on site to replace damage sections of track.
TR 8	Track	South Quay	19	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Fair	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be used elsewhere on site to replace damage sections of track.










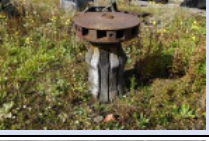

TR 9	Track	East Quay	9	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Poor	Low		Retain and Repair	Tracks retained and used as a feature within new public realm.
TR 10	Track	East Quay	10	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Poor	Low		Retain and Repair	Tracks retained and used as a feature within new public realm.
TR 11	Track	East Quay	10	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Poor	Low		Retain and Repair	Tracks retained and used as a feature within new public realm.
TR 12	Track	East Quay	10	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Unknown	No	No	Poor	Low		Retain and Repair	Tracks retained and used as a feature within new public realm.
TR13	Track	East Quay	19	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Poor	Low		Retain and Repair	Tracks retained and used as a feature within new public realm.
GR1	Gate Rail	East Quay	20	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	Yes	Yes	Poor	Low		Retain and Repair	The track plate will need to be retained and used as an edge for new surface materials.
GR2	Gate Rail	East Quay	15	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	Yes	Yes	Poor	Low		Retain and Repair	The track plate will need to be retained and used as an edge for new surface materials.
GR3	Gate Rail	East Quay	5	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	Yes	Yes	Poor	Low		Retain and Repair	The track plate will need to be retained and used as an edge for new surface materials.
TR14	Track	East Quay	19	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type	Unknown	No	No	Poor	Low		Retain and Repair	Tracks retained and used as a feature within new public realm.
MB22	Type 2 - Mooring Bollard	East Quay	9	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Very Poor	Low		Remove and Dispose	Remove as item is within future pedestrian circulation routes.  Element to be disposed off site.
MB23	Type 3 - Mooring Bollard	East Quay	9	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Retain and Repair	Item is within future pedestrian plaza space. Situating on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB24	Type 3 - Mooring Bollard	East Quay	9	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Retain and Repair	Item is within future pedestrian plaza space. Situating on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.





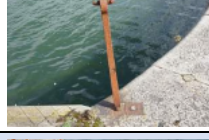

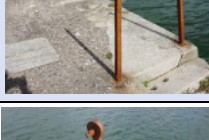





PS58	Post	East Quay	9	•Steel beam cut-off •Rusted/corroded	•An historical artefact of a generic type •Part of the listed dock	Unknown	No	No	Very Poor	Negligible		Remove and Dispose	Remove remnants of post as damaged. Element to be disposed off site.
PS59	Post	East Quay	9	•Steel beam cut-off •Rusted/corroded	•An historical artefact of a generic type •Part of the listed dock	Unknown	No	No	Very Poor	Negligible		Remove and Dispose	Remove remnants of post as damaged. Element to be disposed off site.
FH1	Fire Hydrant	East Quay	10	•Cast iron fire hydrant cover •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	The FH and connected piped services will clash with foundations and will need to be removed.  Included on the Additional Heritage survey.
MB21	Type 3 - Mooring Bollard	East Quay	10	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Retain and Repair	Item is within future pedestrian plaza space. Situating on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
G22	Gulley	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.  Retain in-situ. Protect, during construction works. Replace only if required.  <u>Included on the Additional Heritage survey.</u>
G23	Gulley	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.  Retain in-situ. Protect, during construction works. Replace only if required.  <u>Included on the Additional Heritage survey.</u>
G24	Gulley	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.  Retain in-situ. Protect, during construction works. Replace only if required.  <u>Included on the Additional Heritage survey.</u>
G25	Gulley	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	The Gully is located by the boundary line. it will need structural assessment and risk review to ensure safety. Location appears outside of construction zone.  Retain in-situ. Protect, during construction works. Replace only if required.  <u>Included on the Additional Heritage survey.</u>
GA3	Lock Gate	West Quay	11	•Timber gate •Cast iron fixings	•The lock gates were intrinsic to the working of the docks and thus possess heritage significance in themselves •Part of the listed dock	No	Yes	No	Poor	Medium		Retain and Repair	Repair to former condition (above low water line) and retain as important heritage feature.
HK3	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK4	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK5	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK6	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK7	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.







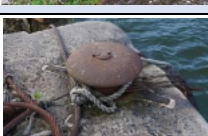




HK8	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK9	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK10	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK11	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Poor	Low		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
HK12	Hook/Chain	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain	Location situated by future parking zone.  Retain in-situ. Protect, if required, during construction works.
FH53	Fire Hydrant	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Retain/ Further Investigation	Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  <u>Included on the Additional Heritage survey.</u>
IC54	Inspection Chamber	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Retain/ Further Investigation	Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification.  If redundant, remove and dispose of cover once chamber is back filled and surfacing works in line with landscape works.  <u>Included on the Additional Heritage survey.</u>
MB66	Type 2 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB67	Type 1 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB68	Type 2 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB70	Type 1 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good..
MB71	Type 1 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB72	Type 1 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.








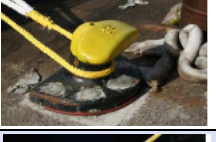


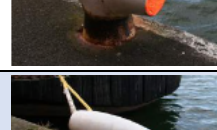
MB73	Type 1 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB74	Type 1 - Mooring Bollard	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Situated on retained dock coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
PS51	Post	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Poor	Medium		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good.
PS52	Post	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Poor	Medium		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good.
PS53	Post	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Poor	Medium		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good.
PS54	Post	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Poor	Medium		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good.
PS55	Post	West Quay	11	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Poor	Medium		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good.
PS77	Post	West Quay	11	•Cast iron •Rusted/corroded surface	•A remnant historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	Yes	Yes	No	Very Poor	Low		Remove and Dispose	Remove and dispose of damaged post.
TM4	Timber	West Quay	11	•Timber edge •Engraved 'criss-cross' pattern •Dimension: 300 (W) x 3300 (L) x 80 (D) mm (approx.)	•Part of the listed dock	No	Yes	No	Poor	Low		Retain and Repair	Situated on retained coping. Ensure structural safety. Retain in-situ. Protect, if required, during construction works. Repair to made good.
CP4	Capstan	West Quay	11	•Cast iron •Rusted/corroded surface •Timber base	•A remnant historical artefact of a generic type	Yes	No	Yes	Poor	Medium		Retain and Repair	Previously identified as a non-designated artefact.  Retain in-situ. Protect, during construction works. Repair to made good.  Included on the Additional Heritage survey.
FH14	Fire Hydrant	South Quay	12	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  The FH and connected piped services will clash with foundations and will need to be removed.  Included on the Additional Heritage survey.

FH15	Fire Hydrant	South Quay	12	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  The FH and connected piped services will clash with foundations and will need to be removed.  Included on the Additional Heritage survey.
FH16	Fire Hydrant	South Quay	12	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  The FH and connected piped services will clash with foundations and will need to be removed.  Included on the Additional Heritage survey.
FH17	Fire Hydrant	South Quay	12	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  The FH and connected piped services will clash with foundations and will need to be removed.  Included on the Additional Heritage survey.
GA4	Lock Gate	South Quay	12	•Timber gate •Cast iron fixings •Rusted/corroded surface	•The lock gate mechanisms were intrinsic to the working of the docks and thus possess heritage significance in themselves •Part of the listed dock	No	Yes	No	Poor	Medium		Retain and Repair	Repair to former condition (above low water line) and retain as important heritage feature.
MB39	Type 3 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB40	Type 3 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB41	Type 3 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB42	Type 3 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB43	Type 3 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB44	Type 1 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works. Element to be stored for future re-use on site.
MB45	Type 1 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB46	Type 2 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated on retained coping.  Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB48	Type 2 - Mooring Bollard	South Quay	12	•Cast iron •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated on retained coping.  Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.



FH8	Fire Hydrant	South Quay	13	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  Fire Hydrant removed as clashes with stadium foundations. Disposed off site.  Included on the Additional Heritage survey.
FH9	Fire Hydrant	South Quay	13	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  Fire Hydrant removed as clashes with stadium foundations. Disposed off site.  Included on the Additional Heritage survey.
FH10	Fire Hydrant	South Quay	13	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  Fire Hydrant removed as clashes with stadium foundations. Disposed off site.  Included on the Additional Heritage survey.
FH11	Fire Hydrant	South Quay	13	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  Fire Hydrant removed as clashes with stadium foundations. Disposed off site.  Included on the Additional Heritage survey.
FH12	Fire Hydrant	South Quay	13	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  Fire Hydrant removed as clashes with stadium foundations. Disposed off site.  Included on the Additional Heritage survey.
FH13	Fire Hydrant	South Quay	13	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint.  Fire Hydrant removed as clashes with stadium foundations. Disposed off site.  Included on the Additional Heritage survey.
MB33	Type 3 - Mooring Bollard	South Quay	13	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB34	Type 3 - Mooring Bollard	South Quay	13	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB35	Type 3 - Mooring Bollard	South Quay	13	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB36	Type 3 - Mooring Bollard	South Quay	13	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Damage has compromised its significance •Part of the listed dock	No	Yes	No	Very Poor	Negligible		Remove and Dispose	Damaged. Remove as sits below proposed stadium footprint. Dispose off site.
MB37	Type 3 - Mooring Bollard	South Quay	13	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB38	Type 3 - Mooring Bollard	South Quay	13	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.










FH2	Fire Hydrant	South/East Quay	14		•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Adjacent to retained dock coping. The FH and connected piped services In construction Zone and will clash with foundations and will need to be removed.  Fire Hydrant removed and disposed off site.  Included on the Additional Heritage survey.
FH3	Fire Hydrant	South/East Quay	14	•Cast iron •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Adjacent to retained dock coping. The FH and connected piped services In construction Zone and will clash with foundations and will need to be removed.  Fire Hydrant removed and disposed off site.  Included on the Additional Heritage survey.
FH5	Fire Hydrant	South/East Quay	14	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint. The FH and connected piped services In construction zone and will clash with foundations and will need to be removed.  Disposed off site.  Included on the Additional Heritage survey.
FH6	Fire Hydrant	South/East Quay	14	•Cast iron fire hydrant cover •Rusted/corroded surface	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint. The FH and connected piped services In construction zone and will clash with foundations and will need to be removed.  Disposed off site.  Included on the Additional Heritage survey.
FH7	Fire Hydrant	South/East Quay	14	•Cast iron fire hydrant cover	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Sits below proposed stadium footprint. The FH and connected piped services In construction zone and will clash with foundations and will need to be removed.  Disposed off site.  Included on the Additional Heritage survey.
IC13	Inspection Chamber	South/East Quay	14		•An artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Retain/ Further Investigation	The inspection chamber will need clearing out, made safe and the cover will need replacing  Included on the Additional Heritage survey.
FH29	Fire Hydrant	South/East Quay	14	•Cast iron fire hydrant cover •Rusted/corroded finish	•An artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Remove and Dispose	Adjacent to retained dock coping. The FH and connected piped services In construction Zone and will clash with foundations and will need to be removed.  Fire Hydrant removed and disposed off site.  Included on the Additional Heritage survey.
MB25	Type 2 - Mooring Bollard	South/East Quay	14	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Remove and Store	Remove as item is within future pedestrian circulation routes.  Element to be stored off site.
MB26	Type 3 - Mooring Bollard	South/East Quay	14	•Cast iron •Rusted/corroded surface •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Store	Remove as item is within future pedestrian circulation routes.  Element to be stored off site.
MB27	Type 3 - Mooring Bollard	South/East Quay	14	•Cast iron low mooring bollard •Rusted/corroded finish at base •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Store	Remove as item is within future pedestrian circulation routes.  Element to be stored off site.
MB28	Type 3 - Mooring Bollard	South/East Quay	14	•Cast iron low mooring bollard •Rusted/corroded finish at base •Painted finish	•An historical artefact of a generic type •Part of the listed dock	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.



MB29	Type 3 - Mooring Bollard	South/East Quay	14	<ul style="list-style-type: none"> <li>•Cast iron low mooring bollard</li> <li>•Rusted/corroded finish at base</li> <li>•Painted finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits within future circulation space and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB30	Type 3 - Mooring Bollard	South/East Quay	14	<ul style="list-style-type: none"> <li>•Cast iron low mooring bollard</li> <li>•Rusted/corroded finish at base</li> <li>•Painted finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits below stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB31	Type 3 - Mooring Bollard	South/East Quay	14	<ul style="list-style-type: none"> <li>•Cast iron low mooring bollard</li> <li>•Rusted/corroded finish at base</li> <li>•Painted finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits below stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
MB32	Type 3 - Mooring Bollard	South/East Quay	14	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> <li>•Painted finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	Yes	No	Sound	Low		Remove and Relocate	Remove as item sits below stadium footprint and is within close proximity to construction works.  Element to be stored for future re-use on site.
DWG2	Dock Wall Gate	East Quay	15	<ul style="list-style-type: none"> <li>•Timber frame</li> <li>•Timber slat infill</li> <li>•Cast iron fixings</li> </ul>	<ul style="list-style-type: none"> <li>•Original timber boundary wall gate</li> </ul>	No	Yes	No	Poor	Low		Retain and Repair	Not previously identified as a designated artefact.  Protect during construction works. Repair to a satisfactory state and tie back in open position behind dock boundary wall.
G72	Gulley	East Quay	15	<ul style="list-style-type: none"> <li>•Cast iron slotted cover</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An artefact of a generic type</li> <li>•Damage has compromised its significance</li> <li>•Part of the listed dock</li> </ul>	Unknown	No	Yes	Poor	Low		Retain/ Further Investigation	Purpose of the chamber to be determined, if remaining in use, replace cover with cover of suitable loading classification. It will need structural assessment and risk review to ensure safety.  Retain in-situ Protect, during construction works. Replace only if required.  <u>Included on the Additional Heritage survey.</u>
GA5	Lock Gate	West Quay	16	<ul style="list-style-type: none"> <li>•Timber gate</li> <li>•Cast iron fixings</li> </ul>	<ul style="list-style-type: none"> <li>•The lock gate and mechanisms were intrinsic to the working of the docks and thus possess heritage significance in themselves.</li> <li>•Part of the listed docks</li> </ul>	No	Yes	No	Poor	Medium		Retain and Repair	Located in close proximity of the construction works. Ensure structural safety. Retain in-situ. Protect, if required, during construction works.  Repair to former condition (above low water line) and retain as important heritage feature.
MB62	Type 1 - Mooring Bollard	West Quay	16	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping.  Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB63	Type 2 - Mooring Bollard	West Quay	16	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated adjacent to retained coping.  Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB64	Type 1 - Mooring Bollard	West Quay	16	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping.  Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB65	Type 1 - Mooring Bollard	West Quay	16	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded finish</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping. Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
PS47	Post	West Quay	16	<ul style="list-style-type: none"> <li>•Cast iron</li> <li>•Rusted/corroded surface</li> </ul>	<ul style="list-style-type: none"> <li>•An historical artefact of a generic type</li> <li>•Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good. May clash with temporary fencing being proposed.

PS48	Post	West Quay	16	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good. May clash with temporary fencing being proposed.
PS49	Post	West Quay	16	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good. May clash with temporary fencing being proposed.
PS50	Post	West Quay	16	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Retain in-situ. Protect, if required, during construction works. Repair to made good. May clash with temporary fencing being proposed.
GA6	Lock Gate	South Quay	17	•Timber gate • Cast iron fixings	•The lock gate and its mechanisms were intrinsic to the working of the docks and thus possess heritage significance in themselves •Part of the listed dock	No	Yes	No	Poor	Medium		Retain and Repair	Located in close proximity of the construction works. Ensure structural safety. Retain in-situ. Protect, if required, during construction works.  Repair to former condition (above low water line) and retain as important heritage feature.
IC41	Inspection Chamber	South Quay	17	•Cast iron cover • Lifting eyes • Rusted/corroded surface • Part covered by vegetation	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Poor	Low		Remove and Dispose	The inspection chamber and connected piped services will clash with foundations and will need to be removed.  Included on the Additional Heritage survey.
MB49	Type 1 - Mooring Bollard	South Quay	17	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping.  Retain in-situ for use during marine works. Protect, if required, during construction works. Repair to make good.
MB50	Type 2 - Mooring Bollard	South Quay	17	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	Yes	No	Sound	Medium		Retain and Repair	Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.  Retain in-situ. Protect, if required, during construction works. Repair to made good.  Had confirmation it can retain from Boskalis
MB51	Type 1 - Mooring Bollard	South Quay	17	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.  Retain in-situ. Protect, if required, during construction works. Repair to made good.  Had confirmation it can retain from Boskalis
MB52	Type 1 - Mooring Bollard	South Quay	17	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.  Retain in-situ. Protect, if required, during construction works. Repair to made good.  Had confirmation it can retain from Boskalis
MB53	Type 1 - Mooring Bollard	South Quay	17	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	Yes	No	Yes	Sound	Medium		Retain and Repair	Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.  Retain in-situ. Protect, if required, during construction works. Repair to made good.  Had confirmation it can retain from Boskalis
MB54	Type 3 - Mooring Bollard	South Quay	17	•Cast iron •Rusted/corroded surface	•An historical artefact of a generic type •Part of the listed dock	No	No	Yes	Sound	Low		Retain and Repair	Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.  Retain in-situ. Protect, if required, during construction works. Repair to made good.  Had confirmation it can retain from Boskalis



PS45	Post	South Quay	17	<ul style="list-style-type: none"> <li>Concrete low bollard</li> <li>Metal post cast in-situ</li> </ul>	<ul style="list-style-type: none"> <li>An artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	No	No	Yes	Poor	Low		Remove and Dispose	<p>Remove as damaged.</p> <p>Element to be disposed off site.</p>
PS46	Post	South Quay	17	<ul style="list-style-type: none"> <li>Concrete low bollard</li> <li>Metal post cast in-situ</li> </ul>	<ul style="list-style-type: none"> <li>An artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	No	No	Yes	Poor	Low		Remove and Dispose	<p>Situated adjacent to retained coping. Close proximity to Red line boundary.</p> <p>Element to be disposed off site.</p>
MB55	Type 3 - Mooring Bollard	South Quay	18		<ul style="list-style-type: none"> <li>An historical artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	Unknown	Unknown	Unknown	Unknown	Low		Retain and Repair	<p>Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.</p> <p>Retain in-situ. Protect, if required, during construction works. Repair to made good.</p> <p>Had confirmation it can retain from Boskalis</p>
MB56	Type 3 - Mooring Bollard	South Quay	18	<ul style="list-style-type: none"> <li>Assume:</li> <li>Cast iron</li> <li>Rusted/corroded finish</li> </ul>	<ul style="list-style-type: none"> <li>An historical artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	Unknown	Unknown	Unknown	Unknown	Low		Retain and Repair	<p>Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.</p> <p>Retain in-situ. Protect, if required, during construction works. Repair to made good.</p> <p>Had confirmation it can retain from Boskalis</p> <p>Clash with Wind Baffle foundations. These foundations may be eliminated which would mean the asset can remain in position. If the foundations remain, the assets will need to be removed and relocated back in the same position once the foundations are complete.</p>
MB57	Type 3 - Mooring Bollard	South Quay	18	<ul style="list-style-type: none"> <li>Cast iron</li> <li>Painted finish</li> <li>Rust/corrosion coming through paint</li> </ul>	<ul style="list-style-type: none"> <li>An historical artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	<p>Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.</p> <p>Retain in-situ. Protect, if required, during construction works. Repair to made good.</p> <p>Had confirmation it can retain from Boskalis</p> <p>Clash with Wind Baffle foundations. These foundations may be eliminated which would mean the asset can remain in position. If the foundations remain, the assets will need to be removed and relocated back in the same position once the foundations are complete.</p>
MB58	Type 1 - Mooring Bollard	South Quay	18	<ul style="list-style-type: none"> <li>Cast iron</li> <li>Painted finish</li> <li>Rust/corrosion coming through paint</li> </ul>	<ul style="list-style-type: none"> <li>An historical artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	<p>Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.</p> <p>Retain in-situ. Protect, if required, during construction works. Repair to made good.</p> <p>Had confirmation it can retain from Boskalis</p>
MB59	Type 1 - Mooring Bollard	South Quay	18	<ul style="list-style-type: none"> <li>Cast iron</li> <li>Painted finish</li> <li>Rust/corrosion coming through paint</li> </ul>	<ul style="list-style-type: none"> <li>An historical artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	Yes	No	Yes	Sound	Medium		Retain and Repair	<p>Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.</p> <p>Retain in-situ. Protect, if required, during construction works. Repair to made good.</p> <p>Had confirmation it can retain from Boskalis</p> <p>Clash with Wind Baffle foundations. These foundations may be eliminated which would mean the asset can remain in position. If the foundations remain, the assets will need to be removed and relocated back in the same position once the foundations are complete.</p>
PS15	Post	South Quay	19	<ul style="list-style-type: none"> <li>Metal post in concrete edge</li> </ul>	<ul style="list-style-type: none"> <li>An artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	No	No	Yes	Poor	Low		Remove and Dispose	<p>Situated adjacent to retained coping. Close proximity to Red line boundary.</p> <p>Remove as damaged. Element to be disposed off site.</p>
MB60	Type 1 - Mooring Bollard	South Quay	19	<ul style="list-style-type: none"> <li>Cast iron</li> <li>Painted yellow</li> </ul>	<ul style="list-style-type: none"> <li>An historical artefact of a generic type</li> <li>Part of the listed dock</li> </ul>	No	No	Yes	Sound	Low		Retain and Repair	<p>Situated adjacent to retained coping. This is located near the proposed Haul road requested by Boskalis.</p> <p>Retain in-situ. Protect, if required, during construction works. Repair to made good.</p> <p>Had confirmation it can retain from Boskalis</p> <p>Clash with Wind Baffle foundations. These foundations may be eliminated which would mean the asset can remain in position. If the foundations remain, the assets will need to be removed and relocated back in the same position once the foundations are complete.</p>

[illegible]