Windows


year warrantee

Doors:

warrantee

properties.

Door steps:

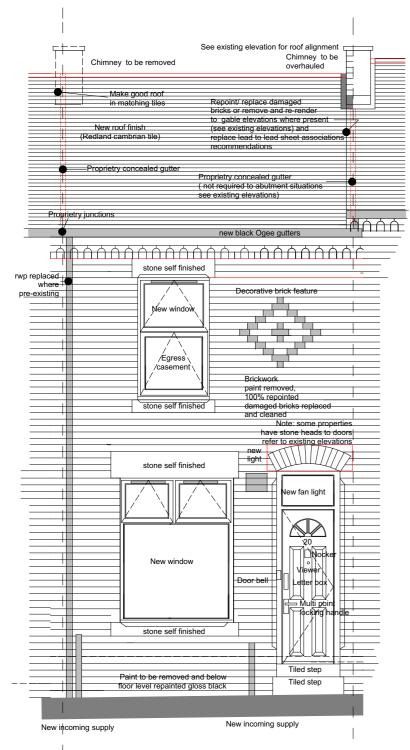

TYPICAL FRONT ELEVATION

(REFER TO EXISTING ELEVATIONS FOR DOOR HEAD AND STEP IN ROOFS TO PARTICULAR DWELLINGS)

Chimney to be removed:

be removed complete and brickwork made good. Roof structure and finish to be replaced (tile match required to adjacent property over party wall) Chimney to be overhauled:

Where stated and/or shown chimney is to be retained and overhauled. Overhauling will involve repointing brickwork upto In the case of 2 storey extensions (where monopitch centre line of party wall replacing any defective bricks with matching. Fitting of new lead flashings to lead sheet associations recommendations. Where chimney is shared

effect adjacent property flues. Replace roof finishes:

laid on 38x50mm tanalised treated roofing battens on breatherabutment shall be fitted with roof tile manufacturers membrane. Redland specmaster specification to be obtained abutment ventilator unit providing 25mm continuous from Redland and fully implimented in all respects using only ventilation and lead abutment and cover flashing Redland approved ancillary items. Provide and fit tile vents to as roof manufacturers detail. each face of roof providing equivilent of 10mm continuous freeflow of air to lofts and 25mm to sloping ceiling situations. allow for checking existing dental course and resetting as In sloping ceiling situations ensure 50mm clearance between required. If units are missing or damaged allow for top of rafter and insulation board (see detail)

Junctions between differing tiles:

and fit proprietry concealed gutter as detail/ agreed. Gutters

Provide and fit new gutters complete to all properties. Front elevations will be black Ogee style gutters. These may be self coloured plastic with proprietry adapter to connect to adjoining property and stop ends where required. Where adapter not available allow for powder coated

aluminium gutter matching adjacent property. Rainwater pipes to be 68mm diameter round self coloured in black, taken to gulley or terminating in shoe matching existina.

Brickwork repointing and repairing:

Brickwork will be repointed 100% to all front elevations, where present

100% to gable elevations and where there is a step in roof level include for repointing these complete.Repointing of rear elevations will be as required and agreed with Architect/ clerk of works to ensure structural integrity and

prevent moisture ingress. Some of these works may require party wall permission and extending scafold over adjoining property this will be included within party wall award and contractors costs. Repointing

colour will be to match 2 Gurnall Street (phase 2 property), except for any yellow bricks which

shall be repointed in yellow mortar, sample to be agreed. Any damaged or perished bricks will be replaced in matching to all elevations. Refer to property specific elevations where brickwork

has been rendered in these cases allowance to be made as below

Existing rendered:

Where existing elevations are rendered, allow for removing

existing render, making good any damaged brickwork and re rendering with through

coloured render to match

approved colour 5 and 7 Randolph Street)

Leadwork:

Where stated and/or shown, chimney and chimney breast is td_eadwork (abutment, apron and gutter etc) to chimneys to be replaced to lead sheet

associations recommendations Where there is a step in roof level allow for replacing abutment step and cover flashings

as lead sheet associations recommendations. extension roof extends above line of main eaves) allow for lead soakers and cover flashings linking in both roof planes as lead sheet associations

fitting of concrete capping to YHG side only, care taken not to recommendations, including timber framing and 15mm external vertical plywood face to support leadwork

Roof finishes to be replaced with Redland Cambrian slate tile In the case of single storey extension the head of roof

Dental course:

replacing with matching.

Miscellaneous fixings

Where adjoining properties have differing roof tiles provide Refer to existing elevations and contractor must inspect during tender period.

Allow for careful removal of all redundant private items, wiring, light, alarm, satalite fittings and the likes and making good any damage to structure.

Prior to commencing works and as soon as possession is provided contractor must fully inspect all elevations for any statuatory services and street furnature which may be present to any elevations. These must (unless otherwise approved)be retained and protected during the works (specific risk assessment to be undertaken as electrical fittings and wiring are likely to be live). Any electrical cables to rear elevations must be highlighted to the Architect no later than 1 week after possesion is granted. The contractor as part of his contractor designed services which include all electrical works (including incoming mains, diversions and meters) will apply for

diversions of these services to allow extensions and insulated render works to progress. Miscellaneous bricking up:

Allow for bricking up old vents and services inlet positions and replacing any damaged bricks using matching bricks, Painted brickwork:

Where present allow for carefully removing existing paint from existing brickwork, prior to repointing and brick overhaul.

A sample are will be produced and offered to architect and/or clerk of works for comments. Due consideration must be given methodology and health and safety and protection provided to ensure no damage structure and finishes, noise is kept the a minimum and not excessive and any residue is contained on site, does not cause a hazard and not allowed to enter the drainage system ...

Stone sills and heads:

Where painted allow for carefully removing all paint finishes to expose stonework. Regardless of whether or not painted carefully inspect all stonework for damage or cracking and undertake stone repair in specialist colour match stone repair system.

Halsall Llovd Partnership ARCHITECTS & DESIGNERS

Liverpool 0151 7088944 Nottingham 0115 9897969 Newcastle 0191 4950055 Preston 01772 719996

Client Your Housing group	Title FRON	r e
Anfield Village Phase 3	Status	
	Job No.	Dr
	2500	FI
This drawing is protected by the copyright of the Halsall Lloyd		

STANDARD (1 AND 2 BED) HOUSE AS PROPOSED

Note : Do not scale off this drawing. Do not rely on this drawing for purposes other than that stated 'Status'.

Read this drawing with all project related Architects drawn and specified information including design risk assessments.

Constructors must be familiar with the client's building asbestos register ahead of facilitating work contained on this drawing.

All windows are to be replaced with white UPVC double glazed units tested to PAS 24 (SBD acredited) having a maximum window U value of 1.4W/M2K.

All ironmongery will be austenetic stainless steel. All bathroom and WC glazing to be in opaque, remaining clear. Adjustable trickle vents within casement to be provided meeting building regulations where individual extract fans are fitted (night vent opening position to casements will not be accepted as being equal).

Sills will project structure minimum 50mm. All perimeter edges will be foam filled and mastic pointed inside and out including under sills using products with 10

All doors are to be replaced with composite door set matching agreed profile (2 Gurnall Street phase 2) black

door, semi circular opening in obscure glass with white frame tested to PAS 24 (SBD acredited) having a maximum door U value of 1.4W/M2K.

All ironmongery will be austenetic stainless steel. All glazing to be in opaque, sills will project structure minimum 50mm, except where this would impinge on the step below in which case subsills will be provided. All perimeter edges will be foam filled and mastic pointed inside and out including under sills using products with 10 year

All door steps are to be tiled with non slip quarry tiles (containing carbarundrum). Ensure that door sill does not obstruct step and if required extend step to minimum 250mm beyond door threshold

Brickwork below Floor level

Finish of brickwork below floor level to be inspected and where in poor condition to be replaced as required and black bitumen painted.

Adjacent properties:

Care to be taken in all operations to ensure that dust and other builders residue does not adverly effect adjoining



www.hlpdesign.com d Partnership Architects & Designers