

TRIAL PIT LOG

Contract: Bramley Moore Dock Wall		Client: Everton FC		Trial Pit: TP02
Contract Ref: 764954	Start: 31.07.19 End: 31.07.19	Ground Level (m AOD): 7.07	National Grid Co-ordinate: E:333657.8 N:392502.4	Sheet: 7 of 7

TP02 Spoil



Method Used: Machine dug	Plant Used: JCB-3CX Backhoe Excavator	Logged By: IHayes	Checked By: M6	
------------------------------------	---	-----------------------------	--------------------------	--




TRIAL PIT LOG

Contract: Bramley Moore Dock Wall			Client: Everton FC		Trial Pit: TP03
Contract Ref: 764954	Start: 31.07.19 End: 31.07.19	Ground Level (m AOD): 7.13	National Grid Co-ordinate: E:333673.3 N:392552.7		Sheet: 1 of 5

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.10 0.10	1 2	D B				MADE GROUND: Dark reddish brown slightly clayey gravelly fine to coarse SAND with medium cobble content of sandstone and brick. Gravel is subangular to rounded fine to coarse of concrete, brick and sandstone.	(0.80) 0.80	
0.80 0.80	3 4	D B				MADE GROUND: Black soft sandy slightly gravelly CLAY. Gravel is subangular with a strong hydrocarbon odour.	(0.30) 1.10	
1.10 1.10	5 6	D B				MADE GROUND: Black yellow and brown very gravelly fine to coarse SAND with a medium cobble content. Gravel is subangular to subrounded fine to coarse of sandstone and occasional concrete.	(0.50) 1.60	
1.60 1.60	7 8	D B				MADE GROUND: Soft brown sandy gravelly CLAY with a low cobble content. Gravel is fine subangular to rounded of mudstone and sandstone.	1.80	
						Trial pit terminated at 1.80m depth.		

Plan (Not to Scale)

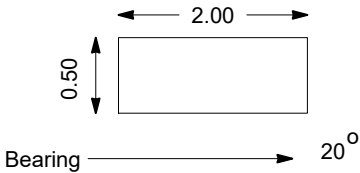


General Remarks

- 1. Cleared with GPR and CAT & Genny.
- 2. West face of pit unstable.
- 3. Pit dry.
- 4. Ground easy to excavate.
- 5. Backfilled with arisings on completion.

All dimensions in metres


Scale: 1:20


Method Used: Machine dug	Plant Used: JCB-3CX Backhoe Excavator	Logged By: IHayes	Checked By: AGS
---------------------------------	--	--------------------------	------------------------

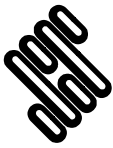

TRIAL PIT LOG

Contract: Bramley Moore Dock Wall		Client: Everton FC		Trial Pit: TP03
Contract Ref: 764954	Start: 31.07.19 End: 31.07.19	Ground Level (m AOD): 7.13	National Grid Co-ordinate: E:333673.3 N:392552.7	Sheet: 2 of 5

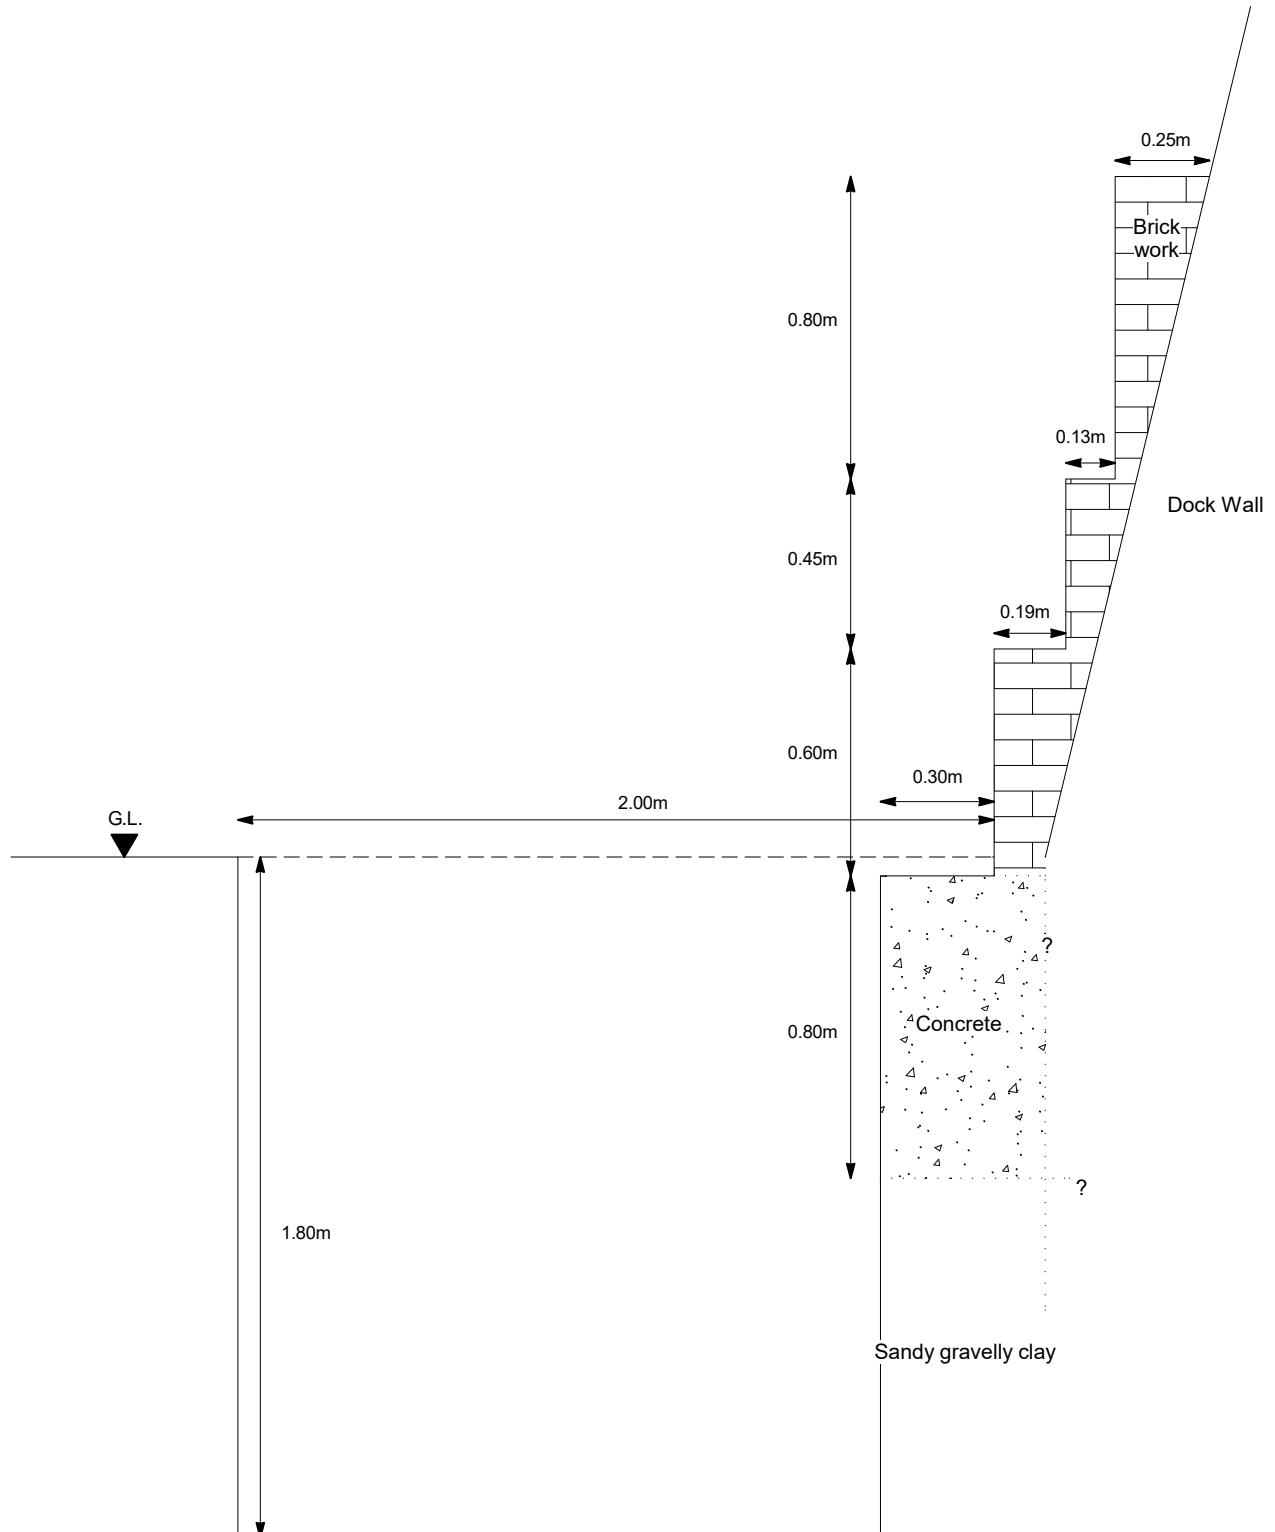

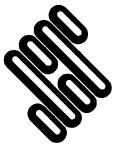

TRIAL PIT LOG


Contract: Bramley Moore Dock Wall		Client: Everton FC		Trial Pit: TP03
Contract Ref: 764954	Start: 31.07.19 End: 31.07.19	Ground Level (m AOD): 7.13	National Grid Co-ordinate: E:333673.3 N:392552.7	Sheet: 3 of 5

TP03 Face A



TP03 Face B

Method Used: Machine dug	Plant Used: JCB-3CX Backhoe Excavator	Logged By: IHayes	Checked By: M6	
------------------------------------	---	-----------------------------	--------------------------	--

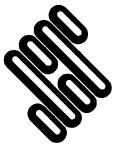

TRIAL PIT LOG

Contract: Bramley Moore Dock Wall		Client: Everton FC		Trial Pit: TP03
Contract Ref: 764954	Start: 31.07.19 End: 31.07.19	Ground Level (m AOD): 7.13	National Grid Co-ordinate: E:333673.3 N:392552.7	Sheet: 4 of 5

TP03 Face C



TP03 Face D

Method Used: Machine dug	Plant Used: JCB-3CX Backhoe Excavator	Logged By: IHayes	Checked By: M6	
---------------------------------	--	--------------------------	-----------------------	--