



TRIAL PIT LOG

Contract: Bramley Moore Dock Wall		Client: Everton FC		Trial Pit: TP03
Contract Ref: 764954	Start: 31.07.19 End: 31.07.19	Ground Level (m AOD): 7.13	National Grid Co-ordinate: E:333673.3 N:392552.7	Sheet: 5 of 5

TP03 Pit Bottom



Method Used: Machine dug	Plant Used: JCB-3CX Backhoe Excavator	Logged By: IHayes	Checked By: M6	
------------------------------------	---	-----------------------------	--------------------------	--




Contract: Bramley Moore Dock Wall			Client: Everton FC		Exploratory position: CR02
Contract Ref: 764954	Date: 30.07.19	Ground Level (m AOD): 7.02	National Grid Co-ordinate: E:333658.7 N:392502.5		Sheet: 3 of 3

Core 02 close up 2



Core 02 close up 3

Method Used: Concrete core	Plant Used: Hilti Concrete Corer	Logged By: IHayes	Checked By: M6	
--------------------------------------	--	-----------------------------	--------------------------	--



GENERAL LOG

Contract: Bramley Moore Dock Wall			Client: Everton FC		Exploratory position: CR03
Contract Ref: 764954	Date: 30.07.19	Ground Level (m AOD): 7.96	National Grid Co-ordinate: E:333675.8 N:392555.5		Sheet: 1 of 3

Depth	Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
0.00-0.54			<p>Very strong yellowish grey with black specks of pyrite and augite GRANITE/Strong light grey & grey gravelly HYDRAULIC CEMENT with medium cobble content sub-angular 20-60mm of sandstone rubble. Gravel is angular to rounded 1-3mm of sandstone, quartzite and augite. 10% voids, 2-20mm. (MADE GROUND) ... Granite bisected by hydraulic cement.</p> <p>... Mix of granite and concrete.</p> <p>... Granite bisected by hydraulic cement.</p>	(0.54)	
			Core terminated at 0.54m distance (thickness of wall).	0.54	

General Remarks


- Hole backfilled with concrete and re-faced with existing granite facings upon completion.
- Dockside wall 4.0m high, granite facings with sandstone rubble & hydraulic cement fill. Topped with flush rounded coping stones of granite.
- Horizontal concrete core through wall at 0 degrees from horizontal.

All dimensions in metres

Scale:

1:3

Method Used: Concrete core	Plant Used: Hilti Concrete Corer	Logged By: IHayes	Checked By: AGS
--------------------------------------	--	-----------------------------	---------------------------

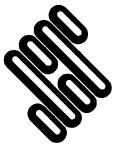

Contract: Bramley Moore Dock Wall			Client: Everton FC		Exploratory position: CR03
Contract Ref: 764954	Date: 30.07.19	Ground Level (m AOD): 7.96	National Grid Co-ordinate: E:333675.8 N:392555.5		Sheet: 2 of 3

Core 03



Core 03 close up 1

GINT LIBRARY V8 07.GLB LibVersion: v8.07.001 PriVersion: v8.07 | Log GENERAL LOG - A4P | 764954 - BRAMLEY MOORE DOCK WALL.GPJ - v8.07.
Structural Soils Ltd, Branch Office - Castleford, The Potteries, Pottery Street, Castleford, West Yorkshire, WF10 1NJ. Tel: 01977-552255, Fax: 01977-552259, Web: www.soils.co.uk, Email: ask@soils.co.uk | 28/10/19 - 15:02 | MG1 |

Method Used: Concrete core	Plant Used: Hilti Concrete Corer	Logged By: IHayes	Checked By: M6	
--------------------------------------	--	-----------------------------	--------------------------	--